

DYNOTEC

INDUSTRIES


TECHNICAL SERVICE BULLETIN

4T65E 2006 AND LATER CHEVROLET "W" (IMPALA & MONTE CARLO) RPO# MN7 or M15

SHIFTER WILL NOT MOVE OUT OF PARK

May have the following symptoms:

- Turn signal operation
(right rear turn lights are inoperable while the right front lights operate correctly).
 - Electric trunk switch will not operate.
 - **BTSI (Brake Shift Interlock Solenoid) does not allow transmission to be shifted from park.**
- Label of the fuses in this vehicle can lead to diagnostic issues for the above concerns. The 15 amp fuse labeled "RT" T/SIG located in the UBEC (Under-hood Bussed Electrical Center) will cause the problems described above if it is bad.

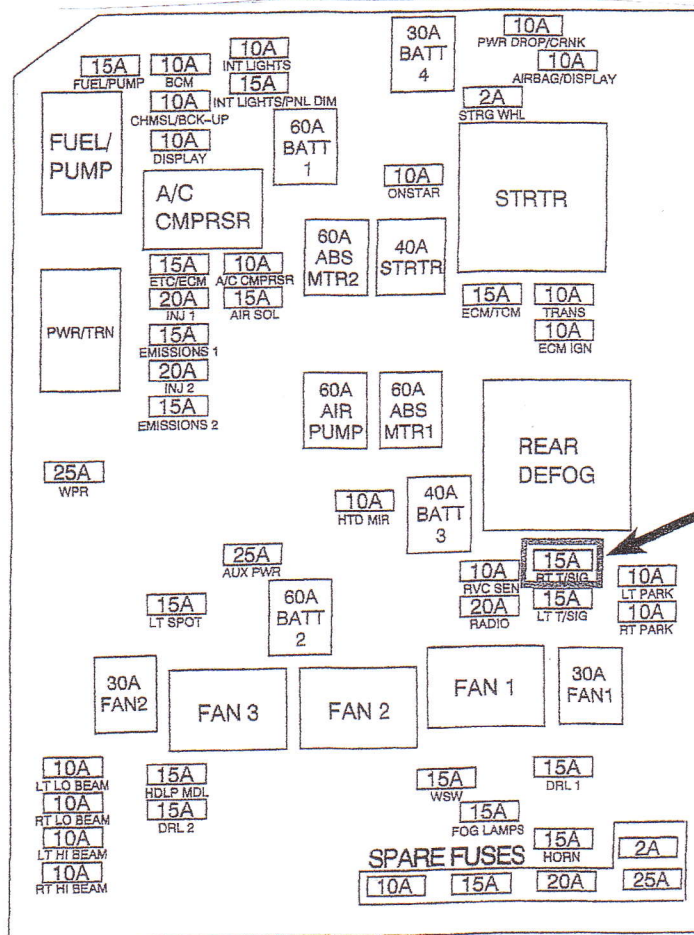

Replace the fuse if it is open.